

REPORT

London Leisure Centre Pools

24th January 2009

Diving Operator:-

Underwater Reporting
Mote Park
Maidstone
Kent
ME15 7SX
Tel:-01622 754280

Inspection – 19th January 2009:-

To photograph/survey underwater where applicable, to a maximum depth of 3.8 metres, two swimming pools at the above complex, comprising Main Pool and Dive Pool for damage, compile findings and provide applicable digital photographs.

MAIN POOL Survey Time:- 10.30- 12.45

Inspection Findings

Area 1

Between the base of the pool and upright approximately 9 metres from the deep end of the pool (W side) there is a gap in the mastic seal –see photograph 1.



Area 2

Second tile line up from the base of the pool, approximately 3.95 metres from the deep end of the pool (E side), cracking is evident in the tile grouting – see photograph 2




Area 3

Second tile line down along the pool wall, approximately 1.5 metres from the deep end of the pool (E side), cracking is evident in the tile grouting – see photograph 3



Area 4

In the area of and around the water inlet in the shallow end of the pool (E), the pool wall is bowing out by 55mm. When investigated by the removal of one tile, it appears that the render along this area has separated from the concrete main structure creating a gap – see photographs 4 & 5.

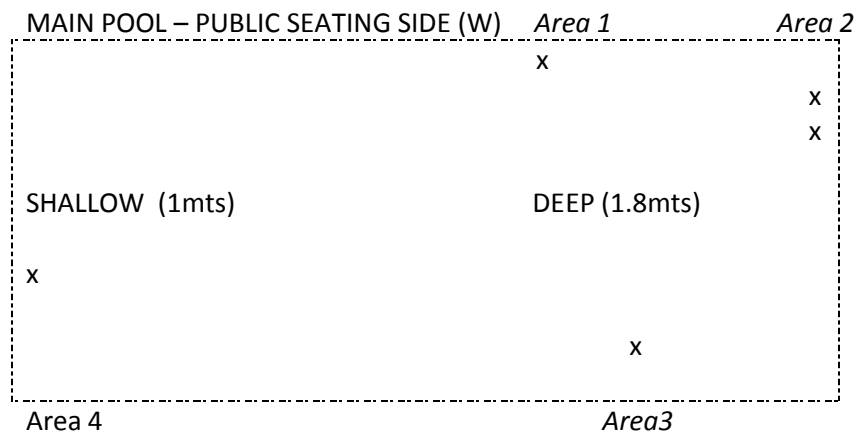

DIVE POOL *Survey Time:-13.50-14.55*

Inspection Findings

No obvious problems – all grouting/mastic/expansion joints satisfactory. Pool is in need of cleaning and chlorine level is low.

John Bartlett
Master Instructor Diver